


INFORMATION Redacted PURSUANT TO THE FREEDOM OF

 <p>U.S. Department of Transportation National Highway Traffic Safety Administration</p>		<p>Vehicle Owner's Questionnaire To Report Vehicle Safety Defects 1-888-DASH-2-DOT (1-888-327-4236) INTERNET: www.nhtsa.dot.gov/hotline</p>		<p>FOR AGENCY USE ONLY 100148</p>	
		<p>Date Received: 08-APR-2016</p>		<p>Repository <input type="checkbox"/></p> <p>Reference No.: 10854319</p>	
OWNER INFORMATION (Type or Print)					
Name: [REDACTED]			Daytime Telephone Number: [REDACTED]		E-mail Address:
Address: [REDACTED]			Evening Telephone Number: same		
City: DEPEW	State: NY	Zip Code: [REDACTED]			
<p><i>The information you provide will be used to identify potential safety-related defects. We may share your information with the applicable vehicle manufacturer during an investigation or recall in accordance with the routine uses described in the agency's Privacy Act notice. See 49 FR 53971 (Sep. 3, 2004).</i></p>					
VEHICLE INFORMATION					
17 digit Vehicle Identification Number Located at bottom of windshield on driver's side 1GCVKREC6EZ [REDACTED]		Make: CHEVROLET	Model: SILVERADO	Model Year: 2014	
Date Purchased: Jan 12-15	Dealer's Name and Telephone Number: Paddock Chevy 716 876 0945		Engine: 5.3 L	Fuel Type: gas	
Original Owner: <input type="checkbox"/>	Dealer's City:	State:	Zip Code:	No. of Cylinders: 8	
Transmission Type: auto	<input checked="" type="checkbox"/> Antilock Brakes	Powertrain:	Multiple Failure: yes vibration	Incident Date(s): 01-FEB-2015	
	<input checked="" type="checkbox"/> Cruise Control				
FAILED COMPONENT(S)/PART(S) INFORMATION					
Vehicle Component Codes: 100000 POWER TRAIN, 022000 SUSPENSION: REAR				Failure Mileage: 3000	Failure Speed: 25
ADDITIONAL ITEMS TO BE COMPLETED WHEN REPORTING A TIRE FAILURE					
Tire Make:	Tire Model (Name or Number):		Tire Size (Example P215/65R15):		
DOT No. (Example: DOTM19ABC036):	<input type="checkbox"/> Original Equipment	Failure Location:			
	<input type="checkbox"/> Prior Repair				
Tire Component Code:			Tire Failure Type:		
ADDITIONAL ITEMS TO BE COMPLETED WHEN REPORTING A CHILD SEAT FAILURE					
Make:	Date Manufactured:	Model No./Name:			
Seat Type:	Installation System:				
Child Seat Component Code:	Failed Part:				
APPLICABLE INCIDENT INFORMATION					
(Please describe in detail the incident(s), Failure(s), Crash(es), and injury(ies).)					
Crash: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Fire: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Number of Persons Injured:	Number of Deaths:	Reported to Police: N	
<p>Narrative Description of Incident(S), Crash(es), and Injury(ies). Please describe (1) events leading up to the failure, (2) failure and its consequences, and (3) what was done to correct the failure; i.e., parts repaired or replaced (and if old part is available).</p>					
<p>TL* THE CONTACT OWNS A 2014 CHEVROLET SILVERADO. WHILE DRIVING APPROXIMATELY 25 MPH, THE REAR OF THE VEHICLE VIBRATED WITHOUT WARNING. THE VEHICLE WAS TAKEN TO A LOCAL DEALER WHERE IT WAS DIAGNOSED THAT THE TIRES NEEDED TO BE REPLACED. THE CONTACT REPLACED THE TIRES, BUT THE FAILURE RECURRED. THE VEHICLE WAS TAKEN TO ANOTHER LOCAL DEALER WHERE IT WAS DIAGNOSED THAT THE FAILURE WAS A KNOWN ISSUE WITHOUT A REMEDY. THE VIBRATION BECAME WORSE, CAUSING MOTION SICKNESS FOR THE DRIVER. THE MANUFACTURER WAS MADE AWARE OF THE FAILURE AND STATED THAT IT WAS A KNOWN ISSUE AND THAT THE REMEDY WAS NOT WORKED OUT YET. THE VEHICLE WAS NOT REPAIRED. THE FAILURE MILEAGE WAS LESS THAN 3,000.</p>					
<p>Include, if available: Police/Fire Department Report, Photos, and Repair Invoice. ATTACH ADDITIONAL SHEETS IF NECESSARY</p>					
<p>The Privacy Act of 1974-Public Law 93-579 This information is requested pursuant to authority vested in the National Highway Traffic Safety Act and subsequent amendments. You are under no obligation to respond this questionnaire. Your response may be used to assist the NHTSA in determining whether a Manufacturer should take appropriate action to correct a safety defect. If the NHTSA proceeds with administrative enforcement or litigation against a manufacturer, your response, or a statistical summary thereof, may be used in support of the agency's action.</p>					

Narrative Description of Incident(s), Failure(s), Crash(es), and Injury(ies)

When I purchased my truck in 2015, thought the vibration was from ruff winter and snow on streets. Problem never stopped after snow melted. My truck vibrates so bad at higher speeds that it feels like rear wheels are bouncing off the pavement. Cant go on any trips with family on the thruway account of the vibration being that bad. Chevy (1-800-222-1020) Told me sorry that theres no fix for the problem and they would make a 1st month payment to

ATTACH ADDITIONAL SHEETS IF NECESSARY

I did not accept the payment. ← bank. \$305.00

U.S. Department
of Transportation

**National Highway
Traffic Safety
Administration**

1200 New Jersey Avenue SE,
Washington, D.C. 20077-9382

Official Business
Penalty for Private Use \$300



**NO POSTAGE
NECESSARY
IF MAILED
IN THE
UNITED STATES**



BUSINESS REPLY MAIL

FIRST CLASS MAIL

PERMIT NO. 1888

WASHINGTON, DC

POSTAGE WILL BE PAID BY ADDRESSEE

**US Department of Transportation
National Highway Traffic Safety Administration
Office of Defects Investigation, NEF-100
1200 New Jersey Avenue SE.
Washington, D.C. 20077-9382**



**Think your vehicle
has a safety defect?**



If so:

**Use the enclosed
form to file a report.**

or visit:

www.safercar.gov

or call:

**Vehicle Safety Hotline
888-327-4236**



Vehicle Owner's Questionnaire (VOQ)
U.S. Department of Transportation
National Highway Traffic Safety Administration





IMPORTANT SAFETY RECALL

May 2016

Depew, NY

This notice applies to your vehicle, VIN: 1GCVKREC6EZ

Dear

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act.

General Motors has decided that a defect which relates to motor vehicle safety exists in certain 2014 model year Chevrolet Silverado vehicles. As a result, GM is conducting a safety recall. We apologize for this inconvenience. However, we are concerned about your safety and continued satisfaction with our products.

IMPORTANT

- Your vehicle is involved in GM safety recall 15822.

Why is your vehicle being recalled?

The flexible steel cable that connects the driver's seat belt to the outboard side of the seat (the "tensioner cable") can fatigue and separate over time as a result of occupant movement into the driver's seat. In a crash, a fatigued tensioner cable could break, reducing the effectiveness of the vehicle's seat belts increasing the risk of injury to the driver.

What will we do?

Parts to repair your vehicle are not currently available, but when parts are available, your Chevrolet dealer will enlarge the side shield opening, install a pusher bracket on the tensioner, and if necessary, replace the tensioner assembly. This service will be performed for you at **no charge**.

We are working as quickly as possible to correct this condition. When parts are available, we will send you another letter asking you to take your vehicle to your Chevrolet dealer to have your vehicle serviced. You can also check the status of this recall at www.my.gm.com/recalls.

Do you have questions?

If you have questions or concerns that your dealer is unable to resolve, please contact the Chevrolet Customer Assistance Center at 1.800.222.1020 (TTY 1.800.833.2438).

GM

If after contacting your dealer and the Customer Assistance Center, you are still not satisfied we have done our best to remedy this condition without charge and within a reasonable time, you may wish to write the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590, or call the toll-free Vehicle Safety Hotline at 1.888.327.4236 (TTY 1.800.424.9153), or go to <http://www.safercar.gov>. The National Highway Traffic Safety Administration Campaign ID Number for this recall is 16V209.

Federal regulation requires that any vehicle lessor receiving this recall notice must forward a copy of this notice to the lessee within ten days.

A handwritten signature in black ink, appearing to read "Jeffrey M. Boyer".

Jeffrey M. Boyer
Vice President
Global Vehicle Safety

GM Recall 15822



Paddock CHEVROLET, Inc.

"GET THE BEST OF US!"

3232 Delaware Ave. Telephone 716-876-0945
KENMORE, NEW YORK 14217
www.paddockchevrolet.com

CUSTOMER NO. [REDACTED]	ADVISOR DAN MACDONNELL	729	TAG NO. w450	INVOICE DATE 05/12/15	INVOICE NO. [REDACTED]
[REDACTED] DEPEW, NY [REDACTED] [REDACTED] [REDACTED]	LABOR RATE	LICENSE NO.	MILEAGE 1,757	COLOR SILVER ICE	STOCK NO. [REDACTED]
	YEAR / MAKE / MODEL 14/CHEVROLET TRUCK/SIERRA 3500/DBL C			DELIVERY DATE 01/12/15	DELIVERY MILES 0
	VEHICLE I.D. NO. 1 G C V K R E C 6 E Z [REDACTED]			SELLING DEALER NO.	PRODUCTION DATE
	F.T.E. NO.			P.O. NO.	R.O. DATE 04/27/15
RESIDENCE PHONE [REDACTED]	BUSINESS PHONE [REDACTED]			COMMENTS E# L83	
					MO: 1764

LABOR & PARTS
J# 1 99CVZAEF01 SERVICE REPAIR TECH(S):5546 WARRANTY

CUSTOMER STATES THERE IS A VIBRATION IN VEHICLE AT ALL SPEEDS, CK AND ADVISE
Verified concern on test drive checked tire balance with road force L/F L/R R/R tires with excess road force. Will need to replace three tires and evaluate customer did not return for tire installation

JOB # 1 TOTAL LABOR & PARTS 0.00

TOTALS-----

*****	TOTAL LABOR....	0.00
* CASH [] CHARGE [] CHECK # []	TOTAL PARTS....	0.00
* CREDIT CARD MC [] VISA [] AMEX []	TOTAL SUBLET...	0.00
* DISCOVER []	TOTAL G.O.G....	0.00
* AUTHORIZATION []	TOTAL MISC CHG.	0.00
* DATE [] INITIALS []	TOTAL MISC DISC	0.00
*****	TOTAL TAX.....	0.00
	TOTAL INVOICE \$	0.00

Parts that are marked with a "*" after the part number have a Limited Lifetime Parts Warranty.

CUSTOMER SIGNATURE

DISCLAIMER OF WARRANTIES

The seller, hereby expressly disclaims all warranties either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

NYS REPAIR SHOP REG. NO.
R150211

ALL PARTS ARE NEW OR
FACTORY REBUILT UNLESS
SPECIFIED OTHERWISE



Paddock CHEVROLET, Inc.

3232 DELAWARE AVENUE
KENMORE, NEW YORK 14217
PHONE: 876-0945
www.paddockchevrolet.com

SALES

SERVICE  PARTS

Thank You!
WE APPRECIATE
YOUR CONFIDENCE IN
OUR DEALERSHIP.



Paddock CHEVROLET, Inc.

"GET THE BEST OF US!"

3232 Delaware Ave.

Telephone 716-876-0945

KENMORE, NEW YORK 14217

www.paddockchevrolet.com

CELL: [REDACTED]

CUSTOMER NO. [REDACTED]	ADVISOR CEASER JREIGE	24753	TAG NO. 645	INVOICE DATE 06/10/15	STOCK NO. [REDACTED]	
[REDACTED] DEPEW, NY [REDACTED] [REDACTED]	LABOR RATE	LICENSE NO.	MILEAGE 2,413	COLOR SILVER ICE	STOCK NO. [REDACTED]	
	YEAR / MAKE / MODEL 14/CHEVROLET TRUCK/SILVERADO 1500/DB			DELIVERY DATE 01/12/15	DELIVERY MILES 0	
	VEHICLE I.D. NO. 1 G C V K R E C 6 E Z			SELLING DEALER NO.	PRODUCTION DATE	
	F.T.E. NO.		P.O. NO.	R.O. DATE 06/06/15		
REFERENCE PHONE [REDACTED]	BUSINESS PHONE [REDACTED]	COMMENTS E# L83				MO: 2414

LABOR & PARTS
J# 1 01CVZ9501 GM MULTI PT INSP TECH(S):8336 INTERNAL
PERFORM GM 27 MULTI POINT INSPECTION
MPI

PARTS	QTY	FP	NUMBER	DESCRIPTION	LIST PRICE	UNIT PRICE
					JOB # 1 TOTAL PARTS	0.00
					JOB # 1 TOTAL LABOR & PARTS	0.00

J# 2 20CVZ WHEEL AND TIRE WORK TECH(S):8336 WARRANTY
CUSTOMER STATES VIBRATION AT ANY SPEED.
SEE CHUCK. CHANGING TIRES
EXCESSIVE ROAD FORCE VARIATION. 0B0R-RHD-1814, TPC 2349.
0B0R-RHD-2414, TPC 2349. 0B0R-RHD-2014, TPC 2349.
MOUNT AND ROAD FORCE BALANCE 3 TIRES ON LEFT FRONT, LEFT
REAR, AND RIGHT REAR PER PREVIOUS DIAGNOSIS. 0B0R-RHD-1814,
TPC 2349. 0B0R-RHD-2414, TPC 2349. 0B0R-RHD-2014, TPC 2349.
labor opp 8060540

PARTS	QTY	FP	NUMBER	DESCRIPTION	LIST PRICE	UNIT PRICE
JOB # 2	3		19190768	B2854522 5.880 N		
JOB # 2	1		15263240	VALVE KIT 5.875 Y		
					JOB # 2 TOTAL PARTS	0.00
					JOB # 2 TOTAL LABOR & PARTS	0.00

J# 3+01CVZZ9003 GMDRAC RENTAL TECH(S):8336 WARRANTY
Added Operation (CEASERJ @ 06/06/2015 14:04)
GMDRAC COURTESY TRANSPORTATION
42.00 PER DAY WARRANTY
RENTAL

PARTS	QTY	FP	NUMBER	DESCRIPTION	LIST PRICE	UNIT PRICE
					JOB # 3 TOTAL PARTS	0.00
					JOB # 3 TOTAL LABOR & PARTS	0.00

DISCLAIMER OF WARRANTIES

The seller, hereby expressly disclaims all warranties either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

NYS REPAIR SHOP REG. NO.
R150211

ALL PARTS ARE NEW OR
FACTORY REBUILT UNLESS
SPECIFIED OTHERWISE



Paddock CHEVROLET, Inc.

3232 DELAWARE AVENUE
KENMORE, NEW YORK 14217
PHONE: 876-0945
www.paddockchevrolet.com

SALES

SERVICE PARTS

Thank You!

WE APPRECIATE
YOUR CONFIDENCE IN
OUR DEALERSHIP.

Called 2/12 440

JOE BASIL CHEVROLET, INC.

5111 TRANSIT ROAD, DEPEW, NEW YORK 14043
Commercial Service: (716) 206-1748 and (716) 206-1716
(716) 683-6800 • www.joebasilchevrolet.com

CUSTOMER #:

INVOICE

Goodwrench Service
Right. On time.

Goodwrench
Auto Body Center

Depew, NY

PAGE 1



GENUINE CHEVROLET

THANK YOU
REPAIR SHOP REG. NO. R5320407



HOME: [REDACTED] CONT: [REDACTED]
BUS: [REDACTED] CELL: [REDACTED]

SERVICE ADVISOR: 2538 JEFFREY POWELL

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
	14	CHEVROLET SILVERADO	1GCVKREC6EZ [REDACTED]		6563/6577	T1369	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN15 IS			17:00 12FEB16		VARI	CASH	12FEB16
01JAN15 DD							
R.O. OPENED		READY	OPTIONS: DLR: [REDACTED] ENG: 5.3_Liter				
19:11 11FEB16		16:35 12FEB16					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CUSTOMER STATES VEHICLE HAS SEVERE VIBRATION AT HIGHWAY SPEEDS.

CAUSE: DRIVELINE

3019959 DRIVELINE/AXLE - CUSTOMER CONCERN NOT
DUPLICATED (CCND)

2082 WC94

(N/C)

FC: 9099 PART#: COUNT:

CLAIM TYPE: ZREG

AUTH CODE:

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00

6563 LOOKED INTO CUSTOMERS CONCERN, VERIFIED ON TEST DRIVE, VEICHL
HAS BEEN PREVIOUSLY WORKED ON AT ANOTHER FACILITY, VEICHL IS SAFE TO
DRIVE, GM IS AWARE OF SITUATION, REPAIR NOT AVAILBLE AT THIS TIME,
CUSTOMER SHOULD FOLLOW UP WITH SELLING DEALER AS THEY HAVE INVOLVED
ENGINEERS IN REPAIR AND PREVIOUS REPAIRS HAVE BEEN MADE ALREADY.

B RECALL 15203 BRAKE LINE BRACKET

CAUSE: RECALL

9101576 Inspect and Tighten Brake Line Bracket
Bolt If Required

2082 WC94

(N/C)

FC: 9090 PART#: COUNT:

CLAIM TYPE: ZFAT

AUTH CODE:

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00

6563 PERFORMED RECALL# 15203, INSPECTED TORQUE SPEC OF BOTH REAR
BRAKE HOSE BOLT, TO SPEC AT 18LBS

C RECALL 15304 TCCM REPROGRAM.

CAUSE: RECALL

9101695 Transfer Case Shift Control Module
Reprogramming with SPS

2082 WC94

(N/C)

ANY WARRANTIES ON THE PRODUCTS SOLD HEREBY ARE THOSE MADE BY THE MANUFACTURER. THE SELLER HEREBY
EXPRESSLY DISCLAIMS ALL WARRANTIES, EITHER EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF
MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER
PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF SAID PRODUCTS.

THE DEALERSHIP UTILIZES THE HOURS PUBLISHED IN THE FACTORY LABOR TIME GUIDE, CHILTON MANUAL AND MOTORS
CRASH BOOK, WHICH REFLECTS AN AVERAGE TIME REQUIREMENT FOR THE PERFORMANCE OF SPECIFIC VEHICLE REPAIRS,
AND WHICH MAY THEREFORE BE EITHER MORE OR LESS THAN THE ACTUAL CLOCK TIME IN ANY GIVEN INSTANCE.

TERMS: STRICTLY CASH OR CREDIT CARD

I HEREBY AUTHORIZE THE REPAIR WORK HEREIN SET FORTH TO BE DONE ALONG WITH THE NECESSARY MATERIAL AND
AGREE THAT YOU ARE NOT RESPONSIBLE FOR LOSS OR DAMAGE TO VEHICLE OR ARTICLES LEFT IN VEHICLE IN CASE OF
FIRE, THEFT OR ANY OTHER CAUSE BEYOND YOUR CONTROL OR FOR ANY DELAYS CAUSED BY UNAVAILABILITY OF PARTS
OR DELAYS IN PARTS SHIPMENTS BY THE SUPPLIER OR TRANSPORTER. I HEREBY GRANT YOU AND/OR YOUR EMPLOYEES
PERMISSION TO OPERATE THE VEHICLE HEREIN DESCRIBED ON STREETS, HIGHWAYS OR ELSEWHERE FOR THE PURPOSE OF
TESTING AND/OR INSPECTION. AN EXPRESS MECHANIC'S LIEN IS HEREBY ACKNOWLEDGED ON ABOVE VEHICLE TO
SECURE THE AMOUNT OF REPAIRS THERETO.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
ENVIRONMENTAL/DEDUCTIBLE	
TOTAL CHARGES	
LESS DISCOUNT	
SALES TAX	
PLEASE PAY THIS AMOUNT	

X

CUSTOMER COPY

CUSTOMER #:

JOE BASIL CHEVROLET, INC.

5111 TRANSIT ROAD, DEPEW, NEW YORK 14043
 Commercial Service: (716) 206-1748 and (716) 206-1716
 (716) 683-6800 · www.joebasilchevrolet.com

INVOICE

 **Goodwrench Service**
 Right On Time.

Goodwrench
 Auto Body Center

DEPEW, NY

PAGE 3



GENUINE CHEVROLET

THANK YOU

REPAIR SHOP REG. NO. R5320407



HOME: CONT:

BUS: CELL:

SERVICE ADVISOR: 2538 JEFFREY POWELL

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
	14	CHEVROLET SILVERADO	1GCVKREC6EZ		6563/6577	T1369	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN15 IS							
01JAN15 DD			17:00 12FEB16		VARI	CASH	12FEB16
R.O. OPENED		READY	OPTIONS: DLR: ENG:5.3_Liter				
19:11 11FEB16		16:35 12FEB16					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	13597803	LATCH					(N/C)

FC: 6065

PART#: 13597803

COUNT: 1

CLAIM TYPE: ZREG

AUTH CODE:

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE G: 0.00

6563 LOOKED INTO CUSTOMERS CONCERN, VERIFIED CAN NOT OPEN PASSANGER
 REAR DOOR FROM INSIDE, REMOVED DOOR PANEL, FOUND INTERNAL FAULT WITH IN
 DOOR LATCH, REPLACED DOOR LATCH- TESTED- OK

H REPLACEMENT RENTAL CAR 1 DAY

CAUSE: RENTAL

Z7901 REPLACEMENT RENTAL CAR 1 DAY

2 WC94

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE H: 0.00 (N/C)

6563 CUSTOMER WENT INTO RENTAL ON THURSDAY 2/11 AT 7PM. VEHICLE WAS
 COMPLETED AND RETURNED TO CUSTOMER ON 2/12. RENTAL VEHICLE VIN
 1GNKRGKD1G. 2016 CHEVY TRAVERSE.

Just what you're looking for

ANY WARRANTIES ON THE PRODUCTS SOLD HEREBY ARE THOSE MADE BY THE MANUFACTURER. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EITHER EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF SAID PRODUCTS.

THE DEALERSHIP UTILIZES THE HOURS PUBLISHED IN THE FACTORY LABOR TIME GUIDE, CHILTON MANUAL AND MOTORS CRASH BOOK, WHICH REFLECTS AN AVERAGE TIME REQUIREMENT FOR THE PERFORMANCE OF SPECIFIC VEHICLE REPAIRS, AND WHICH MAY THEREFORE BE EITHER MORE OR LESS THAN THE ACTUAL CLOCK TIME IN ANY GIVEN INSTANCE.


TERMS: STRICTLY CASH OR CREDIT CARD

I HEREBY AUTHORIZE THE REPAIR WORK HEREIN SET FORTH TO BE DONE ALONG WITH THE NECESSARY MATERIAL AND AGREE THAT YOU ARE NOT RESPONSIBLE FOR LOSS OR DAMAGE TO VEHICLE OR ARTICLES LEFT IN VEHICLE IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE BEYOND YOUR CONTROL OR FOR ANY DELAYS CAUSED BY UNAVAILABILITY OF PARTS OR DELAYS IN PARTS SHIPMENTS BY THE SUPPLIER OR TRANSPORTER. I HEREBY GRANT YOU AND/OR YOUR EMPLOYEES PERMISSION TO OPERATE THE VEHICLE HEREIN DESCRIBED ON STREETS, HIGHWAYS OR ELSEWHERE FOR THE PURPOSE OF TESTING AND/OR INSPECTION. AN EXPRESS MECHANIC'S LIEN IS HEREBY ACKNOWLEDGED ON ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS THERETO.

DESCRIPTION	TOTALS
LABOR AMOUNT	10.00
PARTS AMOUNT	0.00
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
ENVIRONMENTAL/DEDUCTIBLE	0.00
TOTAL CHARGES	10.00
LESS DISCOUNT	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	10.00

X


CUSTOMER COPY

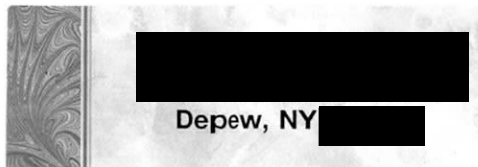

Depew, NY

BUFFALO NY 142

02 JUN 2016 PM 1 L

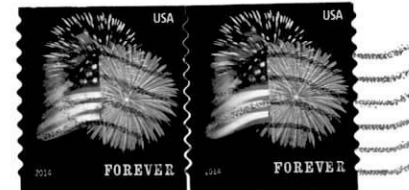

U.S. Department of Transportation
National Highway Traffic Safety Admin.
Office of Defects Investigation, NEF-100
1200 New Jersey Ave. SE.
Washington, D.C. 20077-9382

20077-9382

